




HMD82 (2 × 4 ... 20 mA)

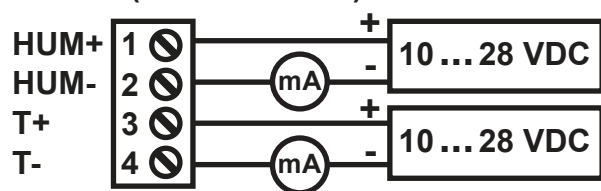

HMD82 WIRING WITH ONE POWER SUPPLY

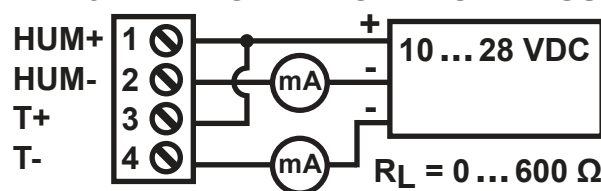


TMD82 (1 × 4 ... 20 mA)

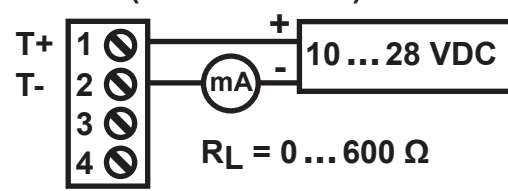


HMD82 / TMD82:
10 ... 28 VDC AT 0 Ω LOAD
20 ... 28 VDC AT 600 Ω LOAD

HMD83 (2 × 0 ... 10 v)

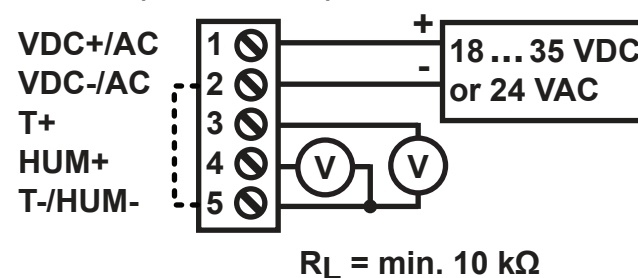

HMD83 / TMD83:
TERMINALS 2 AND 5 ARE INTERNALLY CONNECTED.

TMD83 (1 × 0 ... 10 v)

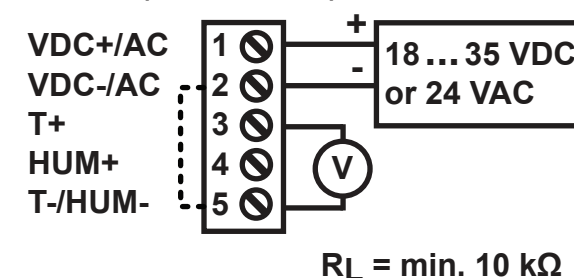


DIP SWITCH FACTORY DEFAULT
HUM = RELATIVE HUMIDITY (RH)
OUTPUT SCALING = 0 ... 100%
DISPLAY UNITS = METRIC

Metric ☒ Non-metric ☐
RH ☒ Td ☐
☒ h ☐
☒ Tw ☐

1 ☒ 2 ☒ 3 ☒ 4 ☒
DEWPOINT (Td)
-40 ... +60 °C
(-40 ... +140 °F)

1 ☒ 2 ☒ 3 ☒ 4 ☒
ENTHALPY (h)
-40 ... +460 KJ/KG
(-10 ... +190 BTU/LB)

1 ☒ 2 ☒ 3 ☒ 4 ☒
WET BULB
TEMPERATURE (Tw)
-40 ... +60 °C
(-40 ... +140 °F)

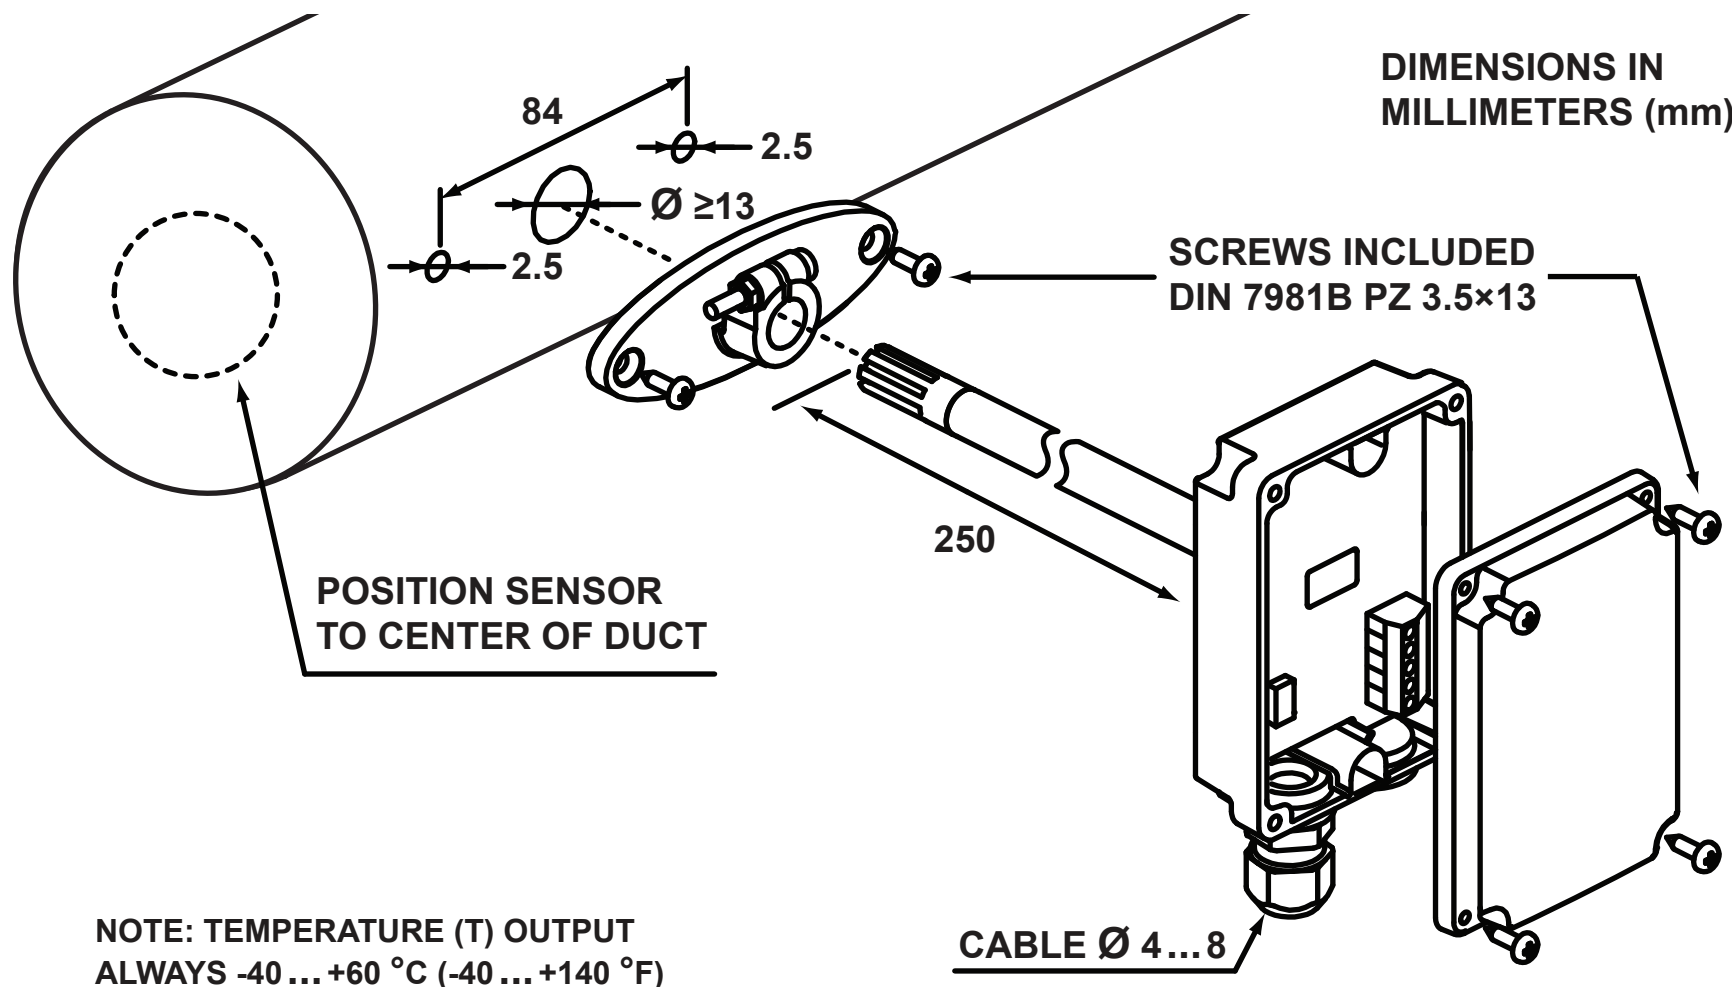

WHEN TRANSMITTER COVER IS OPEN, OBSERVE PRECAUTIONS FOR HANDLING ELECTROSTATIC SENSITIVE DEVICES.

