




DT-1630 HAND HELD & POCKET DIGITAL THERMOMETER

Our most popular, practical and user-friendly model. With **"HI-LOW"** programmable alarm function. With **°C** or **°F** selection, battery and probe.

FEATURES

- Temperature range: **-50°C** to **+300°C** (-58°F to +572°F).
- Read out in Celsius (°C) or Fahrenheit (°F).
- Soft cable with probe: **100 cm** long.
- Stainless steel probe: **10 cm** long (with tip protector).
- Retractable desk stand.
- Resolution: **0,1°C** (0,1°F).
- Accuracy: **± 1°C** from **-20°C** to **+60°C**
± 5°C all other ranges
- Alarm sounds when temperature reaches **"HIGH"** or **"LOW"** values as pre-selected.
- Battery AAA (1,5 V) included.
- Dimensions: **59 mm x 107 mm x 20 mm** (W x H x D).
- 6 months warranty.

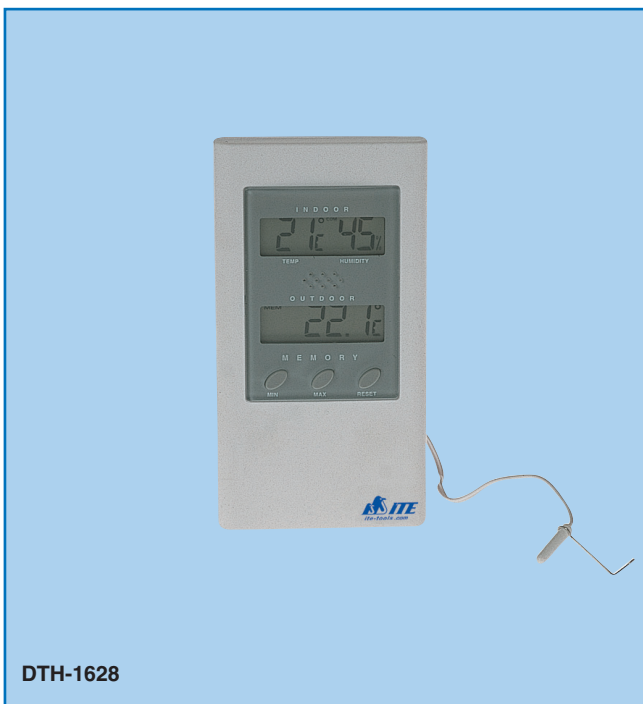

DTH-1628 HAND HELD & POCKET DUAL DIGITAL THERMO-HYGROMETER (°C & °F)

Displays indoor and outdoor temperatures and indoor relative humidity simultaneously.

FEATURES

- Temperature measuring range (unit: indoor sensor) **0°C** to **+50°C** (+32°F to +122°F).
- Temperature measuring range (probe: outdoor sensor) **-50°C** to **+70°C** (-58°F to +158°F).
- Operation temperature: **0°C** to **+50°C** (+32° to +122°F).
- Relative humidity: **25 %** to **95 %** at **+25°C** (+77°F).
- Temperature display resolution indoor sensor: **1°C** (2°F).
- Temperature display resolution outdoor sensor: **0,1°C** (0,1°F)
- Resolution of humidity: **1 %** (Relative Humidity).
- Temperature sampling cycle: 10 seconds.
- Humidity sampling cycle: 10 seconds.
- Selection of Celsius (°C) or Fahrenheit (°F) by slide switch.
- Relative humidity measurement is temperature-compensated.
- **"WET"** Indicator: **Over 65 %** of Relative Humidity.
- **"DRY"** Indicator: **Below 45 %** of Relative Humidity.
- Wall mounting feature.
- 2 batteries AA (1,5 V) included.
- Battery life: **± 1 year**.
- Dimensions: **82 mm x 154 mm x 20,5 mm** (W x H x D).
- 6 months warranty.



SP-120 SOLAR POCKET POWER THERMOMETER

Switchable in Celsius (°C) or Fahrenheit (°F)

FEATURES

- Operates by using ambient light sources.
- Back up battery AAA (1,5 V DC) included.
- Measuring range: **-50°C** to **+70°C** (-58°F to +158°F).
- Resolution: **0,1°C**.
- Accuracy: **± 1,5°C** (± 3°F).
- Ambient temperature: **-18°C** to **+48°C** (0°F to +120°F).
- **47,5 mm x 15,8 mm** LCD display.
- Remote sensor length: 3 meter (120").
- 6 months warranty.